October 2026 – Highways Reactive Tree Works Programme

Introduction

Specialist arboricultural officers have surveyed trees in Heathfield and Fulwell and Hampton Hill wards. These surveys form part of the Council's scheduled four-yearly inspection programme for all Council highway and parks trees. In addition to the scheduled four-yearly inspection programme, the Council's arboricultural officers carry out reactive tree assessments each month, generally in response to customer enquiries.

These inspections are undertaken to support the Council in meeting statutory duties which are highlighted within the Council's Adopted Tree Policy. The Council will now issue this work to its arborist contractor, KPS, for completion over the autumn and winter period.

The surveys have identified trees that can no longer be safely retained and therefore require complete removal. These findings arise within a large tree stock containing specimens of varying ages and conditions. The Council is committed to replacing every tree that is removed and will seek to provide a replacement planting at the earliest suitable opportunity. Replacement planting is dependent on securing the necessary funding and resources for the location.

A notice will be placed on trees identified for removal to explain the proposal and allow sufficient time for residents to submit enquiries. Before removal takes place, separate signage will give the date of the works and ask vehicle owners to keep the relevant parking spaces clear so that the work can proceed safely and without delay.

The following pages list the locations of the trees to be removed, with photographs and inspection findings explaining the reasons for removal.

Dated 29/10/2026

Contents

Barnes	3 - 6
East Sheen	7 - 12
Fulwell and Hampton Hill	13 - 34
Ham, Petersham and Richmond Riverside	35 - 38
Hampton	36
Hampton Wick and South Teddington	40 - 44
Heathfield	45 - 60
Kew	61 - 62
North Richmond	63
South Richmond	64
St Margarets and North Twickenham	65 - 66
Teddington	67
Twickenham Riverside	68 - 70
West Twickenham	71 - 73
Whitton	74 - 75

Barnes

Ward	Barnes
Road	Clavering Avenue
Location	Outside 22
Species	Chanticleer pear (*Pyrus calleryana 'Chanticleer'*)
Height	9.0m
Physiological Condition	Good
Structural Condition	Poor
Inspection findings/reason for exemption	This tree has co-dominant stems with an included weak union creating a point for failure to occur from. A subsidence claim has evidenced seasonal movement; removal is required to prevent natural failure and manage risk.

Site images:



Chanticleer pear outside 22 Clavering Avenue, shown in its street setting.

Ward	Barnes
Road	Westmoreland Road
Location	Outside 13
Species	Common Lime (*Tilia x europaea*)
Height	10.0m
Physiological Condition	Fair
Structural Condition	Poor
Inspection findings/reason for exemption	Investigation with a probe and a resonance test with a sounding hammer has revealed an unacceptable amount of decay beyond the visible cavities at the base of the trunk. Removal is required to prevent natural failure, manage risk, and facilitate replanting.

Site images:

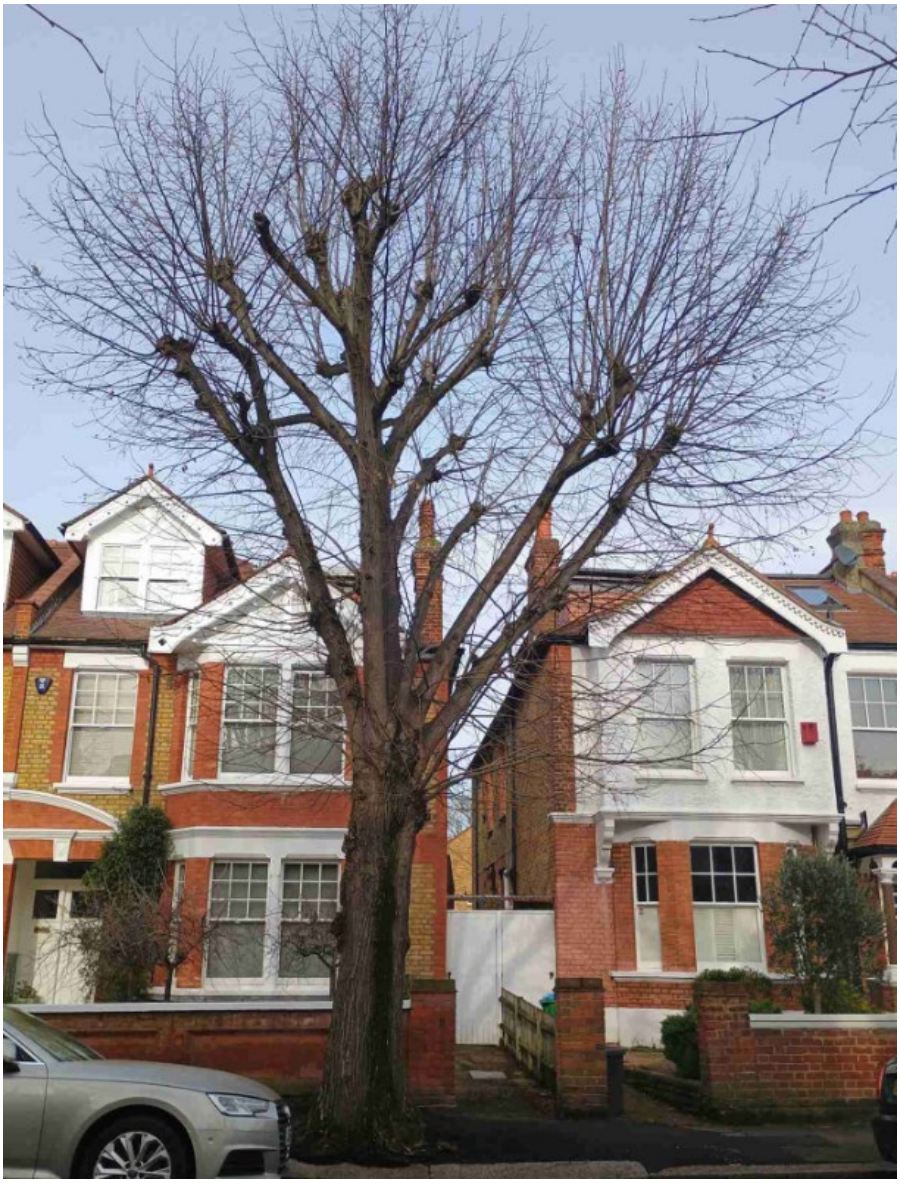


Image shows tree in street scene.



Cavity at the base of the common lime outside 13 Westmoreland Road, circled in the photograph.

Ward	Barnes
Road	Westmoreland Road
Location	Outside 6
Species	Common Lime (*Tilia x europaea*)
Height	6.0m
Physiological Condition	Dead
Structural Condition	Fair
Inspection findings/reason for exemption	This tree is dead; removal is required to prevent natural failure, manage risk, and facilitate replanting

Site images:



Image shows dead tree in street scene.

East Sheen

Ward	East Sheen
Road	Alexandra Road
Location	Outside 2
Species	Cherry plum (*Prunus cerasifera*)
Height	8.5m
Physiological Condition	Fair
Structural Condition	Poor
Inspection findings/reason for exemption	Fungal fruiting bodies of the wood decay fungus *Laetiporus sulphurous* are present on the trunk and stems of this tree. This fungus causes a brown rot which can rapidly reduce wood strength and cause branch or whole tree failure through brittle fracture. Removal is required to prevent natural failure, manage risk, and facilitate replanting

Site images:



Image shows tree in street scene.



Image shows fungal fruiting bodies circled.

Ward	East Sheen
Road	Alexandra Road
Location	Outside 36/38
Species	Apple (*Malus sp.*)
Height	8.0m
Physiological Condition	Dead
Structural Condition	Poor
Inspection findings/reason for exemption	This tree is dead; removal is required to prevent natural failure, manage risk, and facilitate replanting

Site images:



Image shows dead tree in street scene.

Ward	East Sheen
Road	Alexandra Road
Location	Outside 42
Species	Rowan (*Sorbus aucuparia*)
Height	7.0m
Physiological Condition	Dead
Structural Condition	Fair
Inspection findings/reason for exemption	This tree is dead; removal is required to prevent natural failure, manage risk, and facilitate replanting.

Site images:



Image shows dead tree in street scene.

Ward	East Sheen
Road	Richmond Park Road
Location	Outside 2
Species	Sweet gum (*Liquidambar styraciflua*)
Height	10.5m
Physiological Condition	Good
Structural Condition	Good
Inspection findings/reason for exemption	This tree's roots have caused damage to the adjacent public footway and are growing into the neighbouring property, with the potential to damage the boundary wall and footpath. Root pruning is not considered appropriate as this could compromise the health and stability of the tree, and installation of a root barrier is not considered practicable due to underground services. Removal is required to allow the footway to be repaired and made safe and to prevent further damage. This removal has been through the Council's Duty to Consult process, reference DTC005

Site images:



Image shows tree in street scene.

Ward	East Sheen
Road	Temple Sheen
Location	Outside 15
Species	Golden rain tree (*Koelreuteria paniculata)*
Height	7.0m
Physiological Condition	Poor
Structural Condition	Fair
Inspection findings/reason for exemption	This tree is moribund; removal is required to prevent natural failure, manage risk, and facilitate replanting.

Site images:



Golden rain tree outside 15 Temple Sheen, shown in its street setting.

Fulwell and Hampton Hill

Ward	Fulwell and Hampton Hill
Road	St James's Avenue
Location	Outside 50
Species	Apple (*Malus* sp.)
Height	6.5m
Physiological Condition	Fair
Structural Condition	Poor
Inspection findings/reason for exemption	A fungal fruiting body of the species Shaggy Polypore *(Inonotus hispidus*) is present on the trunk; this fungus causes a simultaneous white rot which can cause snapping of tree parts in this species. Removal is required to prevent natural failure, manage risk, and facilitate replanting.

Site images:



Image shows tree in street scene.



Image shows fungal fruiting bodies circled.

Ward	Fulwell and Hampton Hill
Road	Eastbank Road
Location	Opposite 11
Species	Wild Cherry (*Prunus avium)*
Height	5.5m
Physiological Condition	Dead
Structural Condition	Poor
Inspection findings/reason for exemption	This tree is dead; removal is required to prevent natural failure, manage risk, and facilitate replanting

Site images:



Image shows dead tree in street scene.

Ward	Fulwell and Hampton Hill
Road	Eastbank Road
Location	Opposite 10
Species	Rowan (*Sorbus aucuparia)*
Height	5.5m
Physiological Condition	Dead
Structural Condition	Poor
Inspection findings/reason for exemption	This tree is dead; removal is required to prevent natural failure, manage risk, and facilitate replanting

Site images:



Image shows dead tree in street scene.

Ward	Fulwell and Hampton Hill
Road	Park Road
Location	Outside 103
Species	Norway Maple (*Acer platanoides)*
Height	10.0m
Physiological Condition	Poor
Structural Condition	Fair
Inspection findings/reason for exemption	This tree is moribund; removal is required to prevent natural failure, manage risk, and facilitate replanting

Site images:



Image shows moribund tree in street scene.

Ward	Fulwell and Hampton Hill
Road	Burtons Road
Location	Along Road on grass verge
Species	Groups of Elm (*Ulmus* sp.) and unknown dead trees
Height	5.0m-10m
Physiological Condition	Dead
Structural Condition	Fair - Poor
Inspection findings/reason for exemption	These trees are dead; removal is required to prevent natural failure and manage risk

Site images:





Image shows dead trees in street scene.

Ward	Fulwell and Hampton Hill
Road	Burtons Road
Location	Opposite 43
Species	Norway Maple (*Acer platanoides*)
Height	12.0m
Physiological Condition	Poor
Structural Condition	Fair
Inspection findings/reason for exemption	This tree is moribund; removal is required to prevent natural failure, manage risk, and facilitate replanting

Site images:



Image shows moribund tree in street scene.

Ward	Fulwell and Hampton Hill
Road	Burtons Road
Location	///tins.film.remit
Species	Lime (Tilia sp.)
Height	10.0m
Physiological Condition	Dead
Structural Condition	Poor
Inspection findings/reason for exemption	This tree is dead; removal is required to prevent natural failure.

Site images:



Image shows dead tree in street scene.

Ward	Fulwell and Hampton Hill
Road	Burtons Road
Location	///agent.ranch.dome
Species	Norway Maple (*Acer platanoides)*
Height	13.0m
Physiological Condition	Poor
Structural Condition	Fair
Inspection findings/reason for exemption	This tree is moribund; removal is required to prevent natural failure

Site images:



Image shows moribund tree in street scene.

Ward	Fulwell and Hampton Hill
Road	Burtons Road
Location	///liked.enable.clots
Species	Norway Maple (*Acer platanoides*)
Height	12.0m
Physiological Condition	Poor
Structural Condition	Fair
Inspection findings/reason for exemption	This tree is moribund; removal is required to prevent natural failure

Site images:



Image shows moribund tree in street scene.

Ward	Fulwell and Hampton Hill
Road	Burtons Road
Location	Opposite 129/131
Species	Common Ash (*Fraxinus excelsior)*
Height	15.0m
Physiological Condition	Dead
Structural Condition	Poor
Inspection findings/reason for exemption	This tree is dead; removal is required to prevent natural failure

Site images:



Image shows dead tree in street scene.

Ward	Fulwell and Hampton Hill
Road	Burtons Road
Location	Opposite 139
Species	Common Ash (*Fraxinus excelsior)*
Height	14.0m
Physiological Condition	Poor
Structural Condition	Poor
Inspection findings/reason for exemption	This tree is moribund; removal is required to prevent natural failure

Site images:



Image shows moribund tree in street scene.

Ward	Fulwell and Hampton Hill
Road	Burtons Road
Location	Opposite 157
Species	English Oak (*Quercus robur)*
Height	9.0m
Physiological Condition	Dead
Structural Condition	Poor
Inspection findings/reason for exemption	This tree is dead; removal is required to prevent natural failure

Site images:



Image shows dead tree in street scene.

Ward	Fulwell and Hampton Hill
Road	Burtons Road
Location	///began.method.duck
Species	Common Ash (Fraxinus excelsior)
Height	11.0m
Physiological Condition	Dead
Structural Condition	Poor
Inspection findings/reason for exemption	This tree is dead; removal is required to prevent natural failure

Site images:



Image shows dead tree in street scene.

Ward	Fulwell and Hampton Hill
Road	Links View Road
Location	Adjacent to 25 Wellington Road
Species	Privet (*Ligustrum* sp.)
Height	4.5m
Physiological Condition	Poor
Structural Condition	Fair
Inspection findings/reason for exemption	This tree is moribund; removal is required to prevent natural failure, manage risk, and facilitate replanting

Site images:



Image shows moribund tree in street scene.

Ward	Fulwell and Hampton Hill
Road	Oxford Road
Location	Outside 1 A
Species	Cherry (*Prunus* sp.)
Height	6.5m
Physiological Condition	Dead
Structural Condition	Fair
Inspection findings/reason for exemption	This tree is dead; removal is required to prevent natural failure, manage risk, and facilitate replanting

Site images:

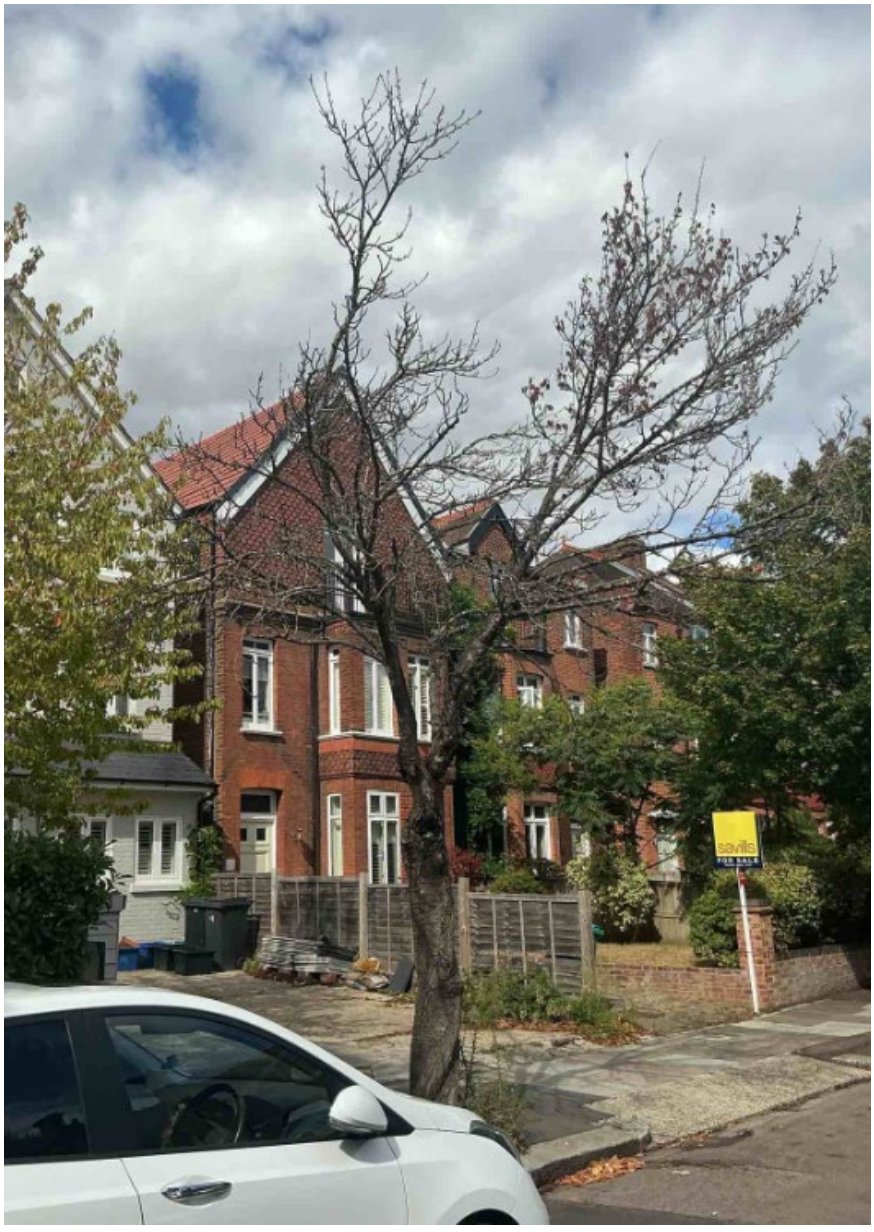


Image shows dead tree in street scene.

Ward	Fulwell and Hampton Hill
Road	Oxford Road
Location	Outside 6/8
Species	Cherry (*Prunus* sp.)
Height	3.0m
Physiological Condition	Poor
Structural Condition	Fair
Inspection findings/reason for exemption	This tree is moribund; removal is required to prevent natural failure, manage risk, and facilitate replanting

Site images:



Image shows moribund tree in street scene.

Ward	Fulwell and Hampton Hill
Road	Connaught Road
Location	Outside 54/56
Species	Apple (*Malus* sp.)
Height	7.5m
Physiological Condition	Poor
Structural Condition	Fair
Inspection findings/reason for exemption	This tree is moribund; removal is required to prevent natural failure, manage risk, and facilitate replanting

Site images:



Image shows moribund tree in street scene.

Ward	Fulwell and Hampton Hill
Road	Blandford Road
Location	Outside 15/15b
Species	Hawthorn (*Crataegus* sp.)
Height	5.0m
Physiological Condition	Poor
Structural Condition	Fair
Inspection findings/reason for exemption	This tree is moribund; removal is required to prevent natural failure, manage risk, and facilitate replanting

Site images:



Image shows moribund tree in street scene.

Ward	Fulwell and Hampton Hill
Road	Stanley Road
Location	Outside 29
Species	Birch (Betula sp.)
Height	4.5m
Physiological Condition	Poor
Structural Condition	Fair
Inspection findings/reason for exemption	This tree has a necrotic bark infection and has failed to thrive. Removal and replacement is required.

Site images:



Image shows tree in street scene.

Ward	Fulwell and Hampton Hill
Road	Victor Road
Location	Outside 106
Species	Grey alder (*Alnus incana)*
Height	3.0m
Physiological Condition	Dead
Structural Condition	Fair
Inspection findings/reason for exemption	This tree is dead; removal is required to prevent natural failure, manage risk, and facilitate replanting

Site images:



Image shows dead tree in street scene.

Ham, Petersham and Richmond Riverside

Ward	Ham, Petersham and Richmond Riverside
Road	Dukes Avenue
Location	Outside 177/179
Species	Wild Cherry (*Prunus avium*)
Height	6.5m
Physiological Condition	Poor
Structural Condition	Poor
Inspection findings/reason for exemption	A fungal fruiting body of the decay fungus *Ganoderma sp*. is present on the trunk. Colonisation by this fungus results in white rot affecting the stem and root system, which can lead to structural failure through fracture or windthrow. Crown dieback is evident and correlates with the presence of the decay fungi. Removal of the tree is recommended to prevent natural failure, manage risk, and facilitate replanting.

Site images:



Image shows moribund tree in street scene



Image shows fungal fruiting body circled.

Ward	Ham, Petersham and Richmond Riverside
Road	Hardwicke Road
Location	Adjacent to 13-17 Hardwicke Road
Species	False Acacia (*Robinia pseudoacacia*)
Height	11.0m
Physiological Condition	Poor
Structural Condition	Poor
Inspection findings/reason for exemption	This tree is moribund; removal is required to prevent natural failure, manage risk, and facilitate replanting

Site images:



Image shows moribund tree in street scene.

Ward	Ham, Petersham and Richmond Riverside
Road	Kingfisher Drive
Location	Outside 39
Species	Birch (*Betula sp.*)
Height	5.0m
Physiological Condition	Dead
Structural Condition	Fair
Inspection findings/reason for exemption	This tree is dead; removal is required to prevent natural failure, manage risk, and facilitate replanting

Site images:



Image shows dead tree in street scene.

Hampton

Ward	Hampton
Road	Church Street
Location	Outside 25
Species	London (*Platanus x acerifolia)*
Height	5.0m
Physiological Condition	Good
Structural Condition	Poor
Inspection findings/reason for exemption	This tree has regrown from a stump and has developed weak, low forks which obstruct the adjacent public footway and have a high risk of splitting. The tree has also caused significant damage to the footway for its size. Pruning and reshaping are not considered suitable to address these issues. Removal is required to allow the footway to be repaired and made safe. This removal has been through the Council's Duty to Consult process, reference DTC003.

Site images:



Image shows tree in street scene.

Hampton Wick and South Teddington

Ward	Hampton Wick and South Teddington
Road	Broom Road
Location	Opposite 154
Species	Himalayan birch (*Betula utilis)*
Height	6.0m
Physiological Condition	Dead
Structural Condition	Fair
Inspection findings/reason for exemption	This tree is dead; removal is required to prevent natural failure, manage risk, and facilitate replanting

Site images:



Image shows dead tree in street scene.

Ward	Hampton Wick and South Teddington
Road	Udney Park Road
Location	Opposite Little Orchard
Species	Silver maple (*Acer saccharinum*)
Height	19.0m
Physiological Condition	Poor
Structural Condition	Fair
Inspection findings/reason for exemption	This tree is moribund; removal is required to prevent natural failure, manage risk, and facilitate replanting.

Site images:



Image shows moribund tree in street scene.

Ward	Hampton Wick and South Teddington
Road	Udney Park Road
Location	Opposite 26 & lamppost 008
Species	Silver maple (*Acer saccharinum*)
Height	17.0m
Physiological Condition	Dead
Structural Condition	Fair
Inspection findings/reason for exemption	This tree is dead; removal is required to prevent natural failure, manage risk, and facilitate replanting.

Site images:



Image shows dead tree in street scene.

Ward	Hampton Wick and South Teddington
Road	Udney Park Road
Location	Opposite 28
Species	Silver maple (*Acer saccharinum*)
Height	18.0m
Physiological Condition	Dead
Structural Condition	Fair
Inspection findings/reason for exemption	This tree is dead; removal is required to prevent natural failure, manage risk, and facilitate replanting.

Site images:



Image shows dead tree in street scene.

Ward	Hampton Wick and South Teddington
Road	Udney Park Road
Location	Opposite 30
Species	Silver maple (*Acer saccharinum*)
Height	16.5m
Physiological Condition	Dead
Structural Condition	Fair
Inspection findings/reason for exemption	This tree is dead; removal is required to prevent natural failure, manage risk, and facilitate replanting.

Site images:



Image shows dead tree in street scene.

Heathfield

Ward	Heathfield
Road	Waverley Avenue
Location	Outside 85/87
Species	Tree of Heaven (*Ailanthus altissima*)
Height	12.0m
Physiological Condition	Poor
Structural Condition	Poor
Inspection findings/reason for exemption	Investigation with a probe and a resonance test with a sounding hammer has revealed an unacceptable amount of decay beyond the visible cavities at the base of the trunk. Removal is required to prevent natural failure, manage risk, and facilitate replanting.

Site images:



Image shows tree is street scene.



Image shows cavity with probe on truck.

Ward	Heathfield
Road	Chiltern Avenue
Location	Adjacent to 95 Powder Mill Lane
Species	Silver birch (*Betula pendula*)
Height	10.0m
Physiological Condition	Fair
Structural Condition	Poor
Inspection findings/reason for exemption	Investigation with a probe and a resonance test with a sounding hammer has revealed an unacceptable amount of decay beyond the visible cavities at the base of the trunk. Removal is required to prevent natural failure, manage risk, and facilitate replanting.

Site images:



Images show tree in street scene.



Images show cavity at base of trunk circled

Ward	Heathfield
Road	Lyndhurst Avenue
Location	Outside 18
Species	Apple (*Malus sp.*)
Height	8.5m
Physiological Condition	Dead
Structural Condition	Fair
Inspection findings/reason for exemption	This tree is dead; removal is required to prevent natural failure, manage risk, and facilitate replanting

Site images:



Image shows dead tree in street scene.

Ward	Heathfield
Road	Ellerman Avenue
Location	On grass triangle by junction to Ellerman Avenue and Lyndhurst Avenue- ///barn.pines.loaded
Species	Cherry Plum (*Prunus cerasifera)*
Height	5.0m
Physiological Condition	Poor
Structural Condition	Fair
Inspection findings/reason for exemption	Cankering and bark necrosis is present on the stem of this tree indicating dysfunction of the vascular system which has led to the tree being moribund; Removal is required to prevent natural failure, manage risk, and facilitate replanting

Site images:



Image shows moribund tree in street scene.



Image shows bark delamination circled.

Ward	Heathfield
Road	Ellerman Avenue
Location	On grass triangle by junction to Ellerman Avenue and Lyndhurst Avenue- ///else.stand.butter
Species	Silver birch (*Betula pendula)*
Height	9.0m
Physiological Condition	Poor
Structural Condition	Poor
Inspection findings/reason for exemption	This tree is moribund; removal is required to prevent natural failure, manage risk, and facilitate replanting

Site images:



Image shows moribund tree in street scene.

Ward	Heathfield
Road	Ellerman Avenue
Location	Outside 17/19
Species	Swedish Whitebeam (*Sorbus x intermedia.*)
Height	7.0m
Physiological Condition	Poor
Structural Condition	Poor
Inspection findings/reason for exemption	A fungal fruiting body of the species Shaggy Polypore (*Inonotus hispidus*) is present on the main stem or trunk, this fungus causes a simultaneous white rot which can cause snapping of tree parts in this particular species; removal is required to prevent natural failure, manage risk, and facilitate replanting

Site images:



Image shows moribund tree in street scene.



Image shows fungal fruiting body circled.

Ward	Heathfield
Road	Ellerman Avenue
Location	Outside 50/52
Species	Sycamore (*Acer pseudoplatanus*)
Height	12.0m
Physiological Condition	Fair
Structural Condition	Poor
Inspection findings/reason for exemption	Investigation with a probe and a resonance test with a sounding hammer has revealed an unacceptable amount of decay beyond the visible cavities at the base of the trunk. Removal is required to prevent natural failure, manage risk, and facilitate replanting.

Site images:



Image shows tree in street scene.



Image shows cavity at base of trunk circled.

Ward	Heathfield
Road	Sheringham Avenue
Location	Outside 22/24
Species	Cherry (*Prunus sp.*)
Height	4.5m
Physiological Condition	Dead
Structural Condition	Fair
Inspection findings/reason for exemption	This tree is dead; removal is required to prevent natural failure, manage risk, and facilitate replanting

Site images:



Image shows dead tree in street scene.

Ward	Heathfield
Road	Lyndhurst Avenue
Location	Outside 242/244
Species	Norway Maple (*Acer platanoides)*
Height	13.5m
Physiological Condition	Good
Structural Condition	Poor
Inspection findings/reason for exemption	Investigation with a probe and a resonance test with a sounding hammer has revealed an unacceptable amount of decay beyond the visible cavities at the base of the trunk. Removal is required to prevent natural failure, manage risk, and facilitate replanting.

Site images:



Image shows dead tree in street scene.



Image shows cavity at base of trunk.

Ward	Heathfield
Road	Albemarle Avenue
Location	Outside 1
Species	Cherry (*Prunus sp.*)
Height	4.5m
Physiological Condition	Dead
Structural Condition	Fair
Inspection findings/reason for exemption	This tree is dead; removal is required to prevent natural failure, manage risk, and facilitate replanting

Site images:



Image shows dead tree in street scene.

Kew

Ward	Kew
Road	Taylor Avenue
Location	Outside 8
Species	False acacia (*Robinia pseudoacacia*)
Height	9.0m
Physiological Condition	Good
Structural Condition	Poor
Inspection findings/reason for exemption	Investigation with a probe and a resonance test with a sounding hammer has revealed an unacceptable amount of decay beyond the visible cavities at the base of the trunk. Removal is required to prevent natural failure, manage risk, and facilitate replanting.

Site images:



Image shows tree in street scene.



Image shows cavities at base of tree circled.

North Richmond

Ward	North Richmond
Road	Sheendale Road
Location	Outside 15 on 14 side of building
Species	Norway maple (*Acer platanoides*)
Height	8.0m
Physiological Condition	Good
Structural Condition	Good
Inspection findings/reason for exemption	This tree's roots have caused significant damage to the adjacent public footway and are growing into the neighbouring property. Root pruning is not considered appropriate as this could compromise the health and stability of the tree. Removal is required to allow the footway to be repaired and made safe. This removal has been through the Council's Duty to Consult process, reference DTC006.

Site images:



Image shows tree in street scene.

South Richmond

Ward	South Richmond
Road	Michelham Gardens
Location	Side of 8 Strawberry Vale
Species	Birch (*Betula* sp.)
Height	5.0m
Physiological Condition	Dead
Structural Condition	Fair
Inspection findings/reason for exemption	This tree is dead; removal is required to prevent natural failure, manage risk, and facilitate replanting

Site images:



Image shows dead tree in street scene.

St Margarets and North Twickenham

Ward	St Margarets and North Twickenham
Road	Kilmorey Gardens
Location	Outside 36
Species	Rowan (*Sorbus aucuparia*)
Height	5.0m
Physiological Condition	Dead
Structural Condition	Fair
Inspection findings/reason for exemption	This tree is dead; removal is required to prevent natural failure, manage risk, and facilitate replanting

Site images:

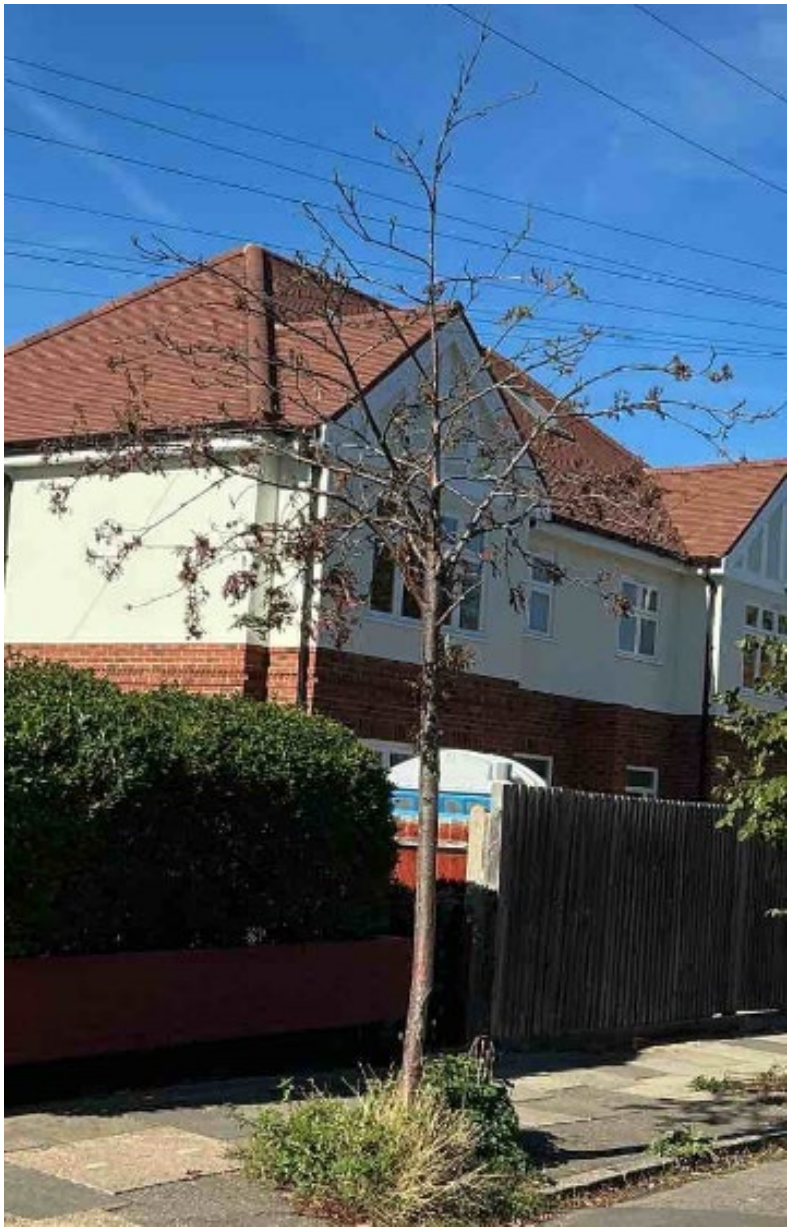


Image shows dead tree in street scene.

Road	Normanhurst Drive
Location	///much.calls.short.
Species	Holly (*Ilex sp.*)
Height	3.0m
Physiological Condition	Dead
Structural Condition	Fair
Inspection findings/reason for exemption	This tree is dead; removal is required to prevent natural failure and manage risk.

Site images:

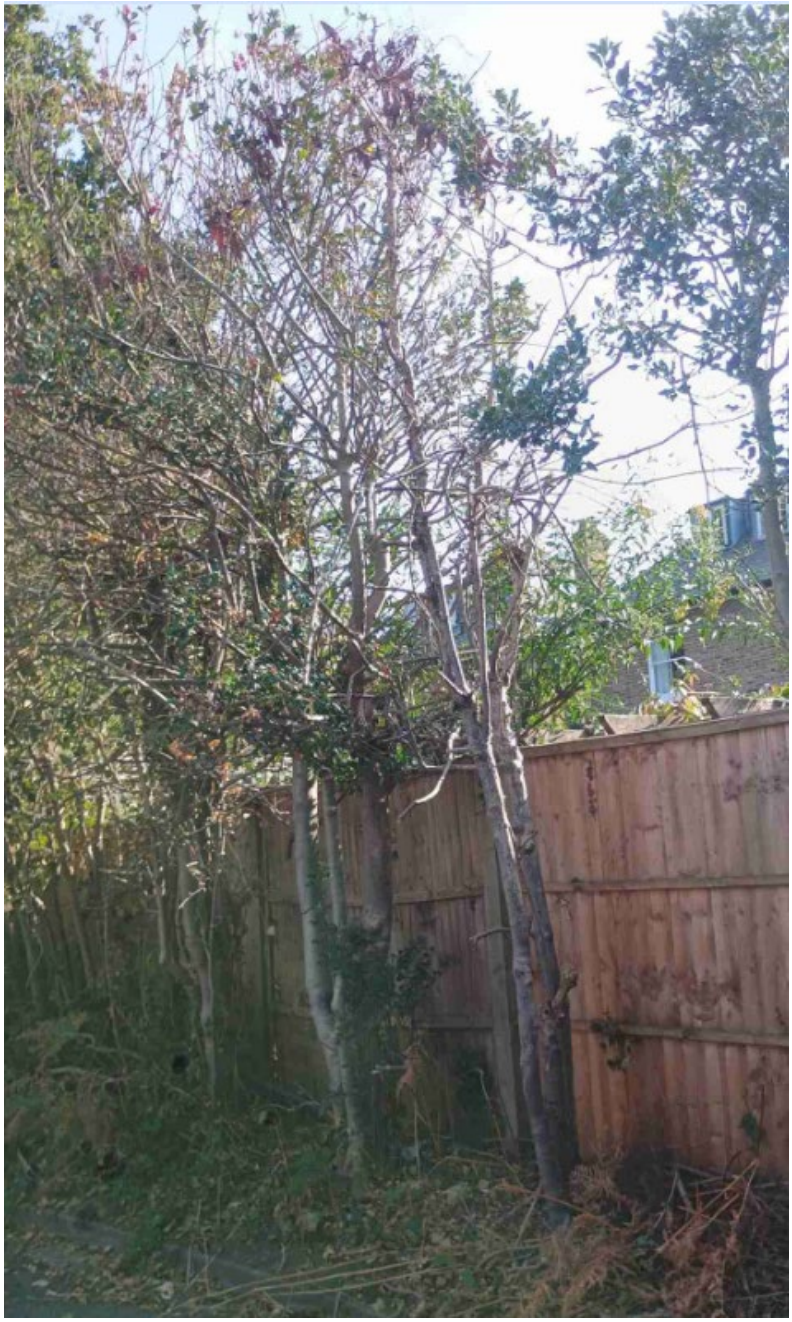


Image shows dead tree in street scene.

Teddington

Ward	Teddington
Road	Clarence Road
Location	Outside 71 Park Road side edge of building
Species	Silver birch (*Betula pendula*)
Height	13.5m
Physiological Condition	Dead
Structural Condition	Fair
Inspection findings/reason for exemption	This tree is dead; removal is required to prevent natural, manage risk, failure and facilitate replanting

Site images:



Image shows dead tree in street scene

Twickenham Riverside

Ward	Twickenham Riverside
Road	Richmond Road
Location	Outside The Royal Oak and directly adjacent to lamppost 001
Species	Raywood ash (*Fraxinus angustifol. 'Raywood')*
Height	14.5m
Physiological Condition	Fair
Structural Condition	Good
Inspection findings/reason for exemption	Tree has raised and damaged roots causing trip hazards and an unacceptable obstruction to the pavement making an impasse for prams & wheelchairs to safely pass. With no engineering solution. Removal is required to remove hazard and facilitate replanting

Site images:



Image shows tree in street scene.



Image shows pavement disruption around tree.

Ward	Twickenham Riverside
Road	York House Gardens
Location	York House car park adjacent to lamp 036
Species	Cherry (*Prunus sp.)*
Height	7.0m
Physiological Condition	Dead
Structural Condition	Fair
Inspection findings/reason for exemption	This tree is dead; removal is required to prevent natural, manage risk, failure and facilitate replanting

Site images:



Image shows dead tree in street scene

West Twickenham

Ward	West Twickenham
Road	Fifth Cross Road
Location	Side of Waldegrave School Gate D OPP Denmark Road
Species	English oak (*Quercus robur*)
Height	21.5m
Physiological Condition	Fair
Structural Condition	Poor
Inspection findings/reason for exemption	A detailed investigation was conducted on the base of the trunk of this tree using sonic tomography. The results of the detailed inspection identified an unacceptable amount of decay, as shown in the light-coloured areas in the image of the cross-section of the stem below, spreading to the sound wood shown as darker-coloured areas. Removal is required to prevent natural, manage risk, failure and facilitate replanting

Site images:



Image shows tree in street scene.

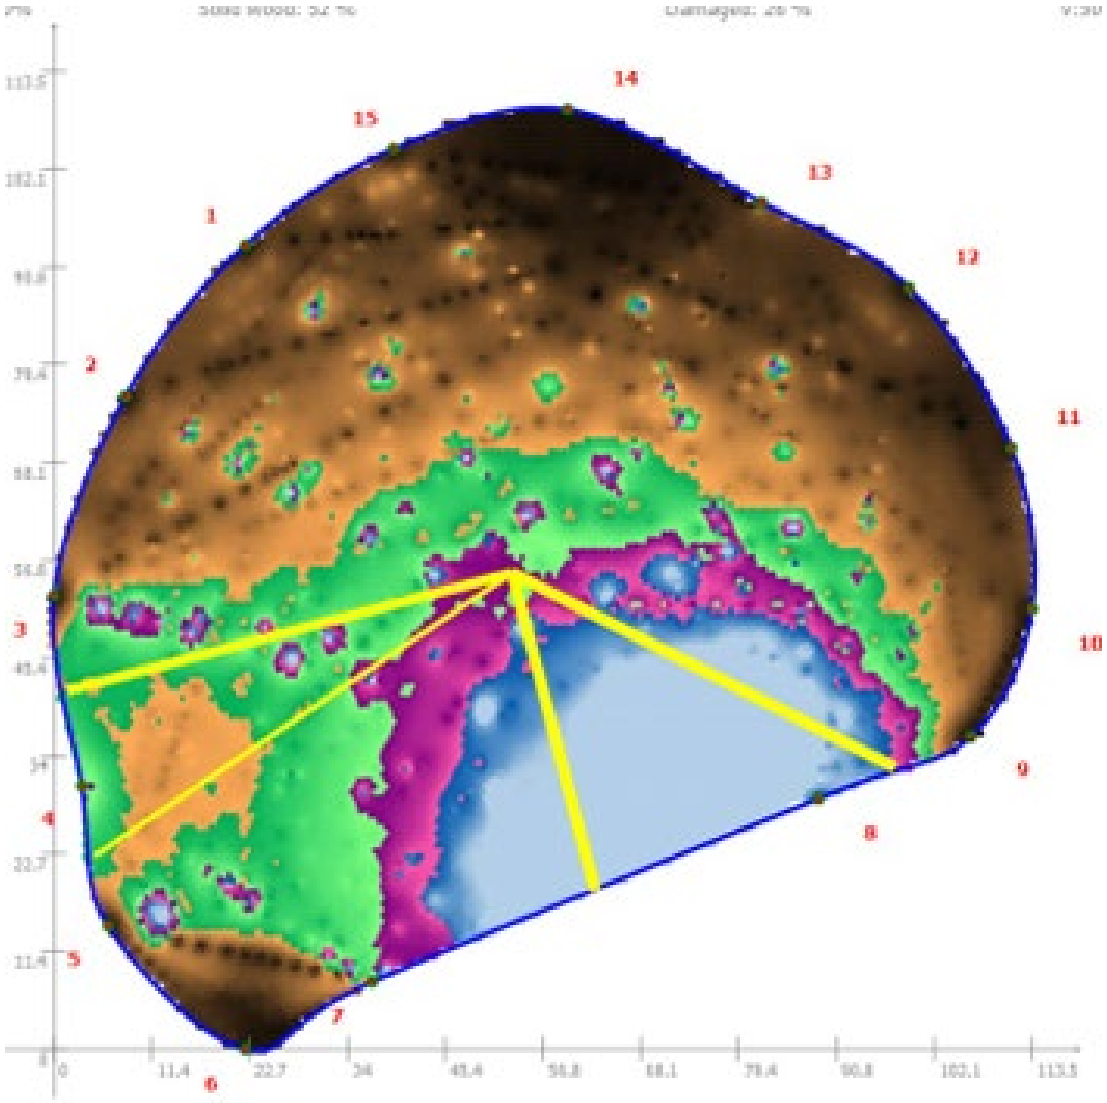


Image shows results from decay detection investigation at the base of the tree – green, blue and purple indicate decayed wood

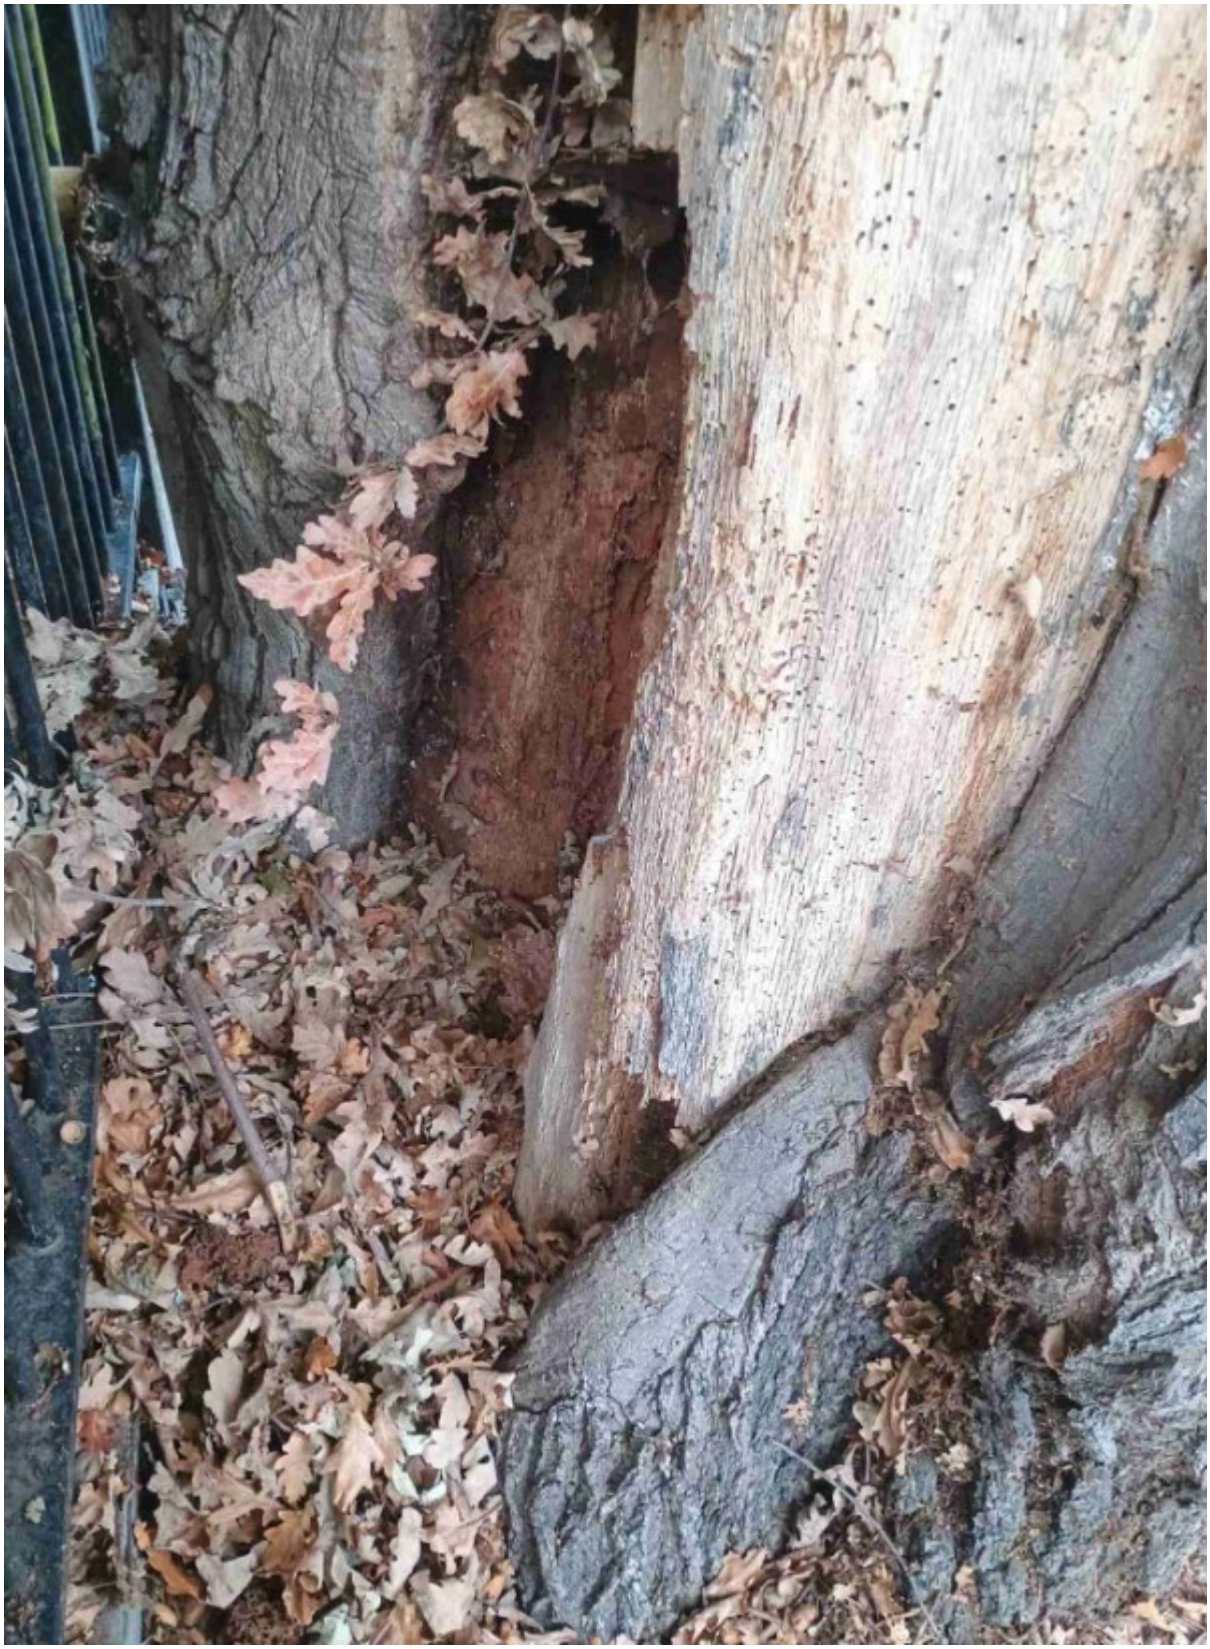


Image shows decay at base of trunk.

Whitton

Ward	Whitton
Road	Redway Drive
Location	Outside 35
Species	Swedish whitebeam (*Sorbus x intermedia)*
Height	7.5m
Physiological Condition	Fair
Structural Condition	Poor
Inspection findings/reason for exemption	Investigation with a probe and a resonance test with a sounding hammer has revealed an unacceptable amount of decay beyond the visible cavities at the top of the trunk in the primary union. Removal is required to prevent natural failure, manage risk, and facilitate replanting.

Site images:

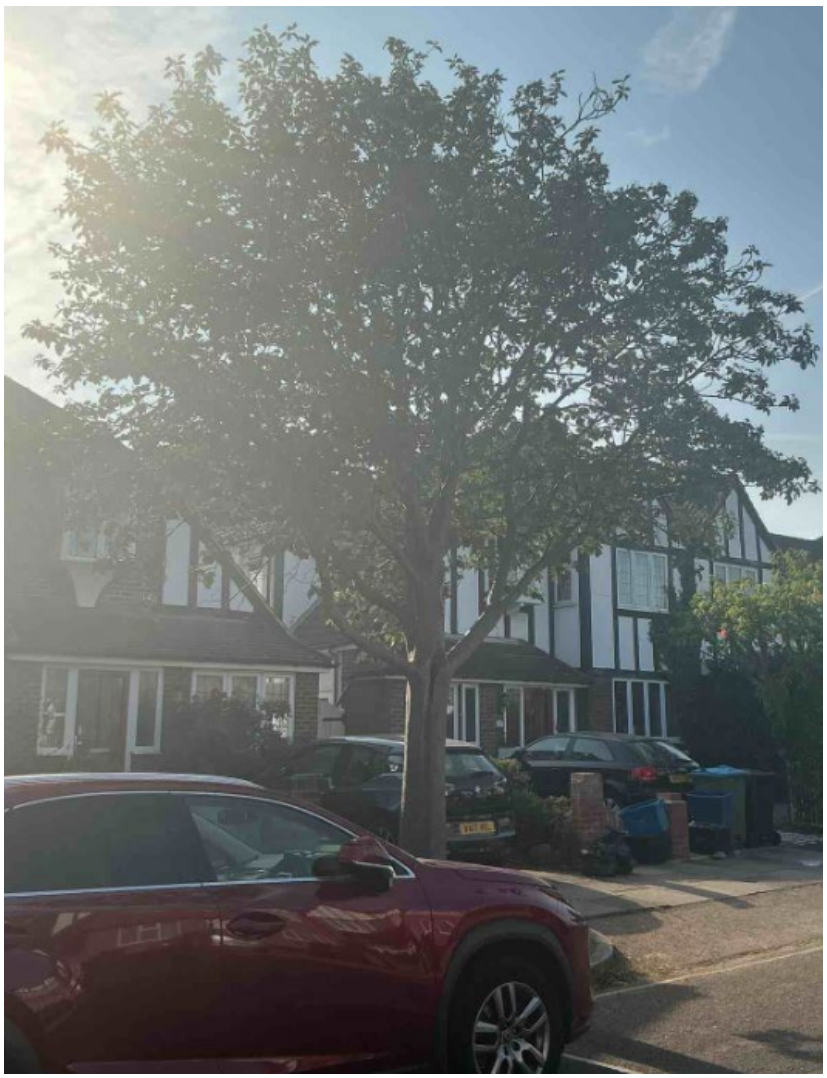


Image shows tree in street scene.

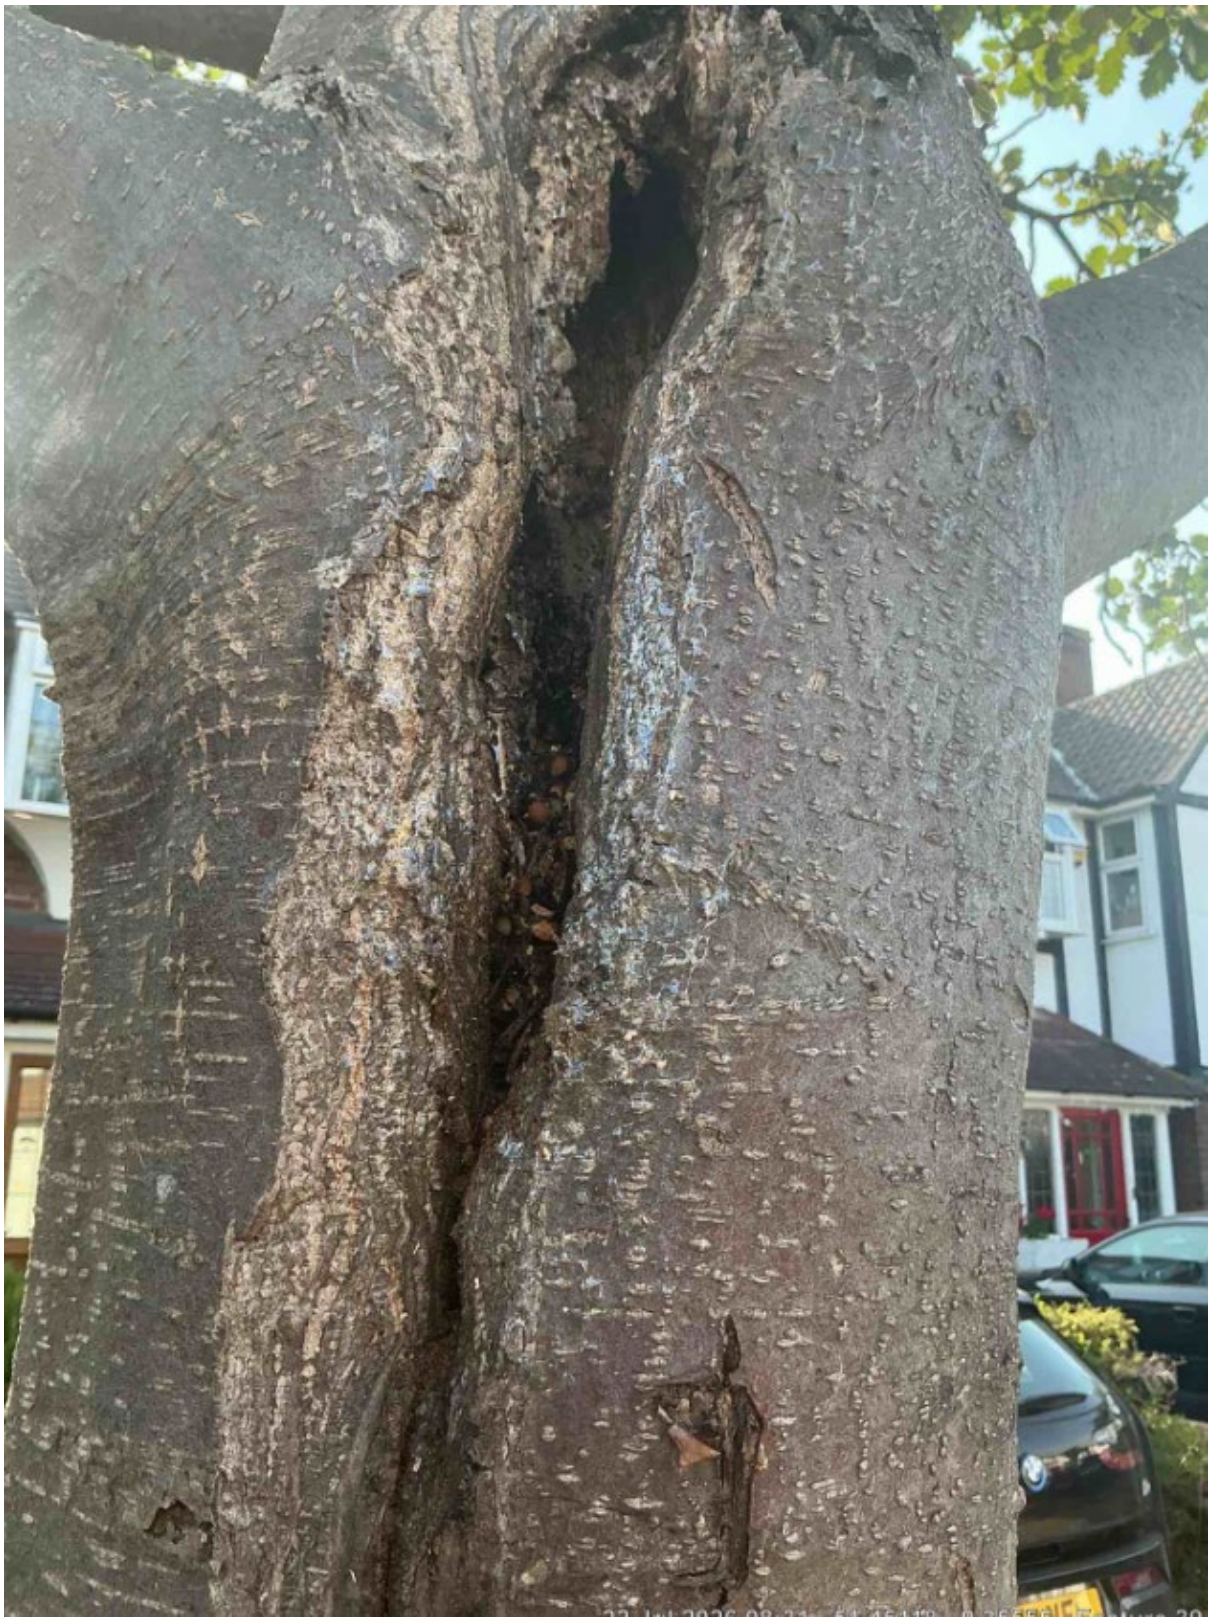


Image shows cavity on trunk.